

MAA dba Dean Aircraft Service  
 2909 Highway 11 South  
 Meridian, MS 39307

# Invoice

Date: 11/1/2010 Invoice #: 357

Due Date: 12/1/2010 Terms: Net 30

Remit Payment to:  
 MAA dba Dean Aircraft Service  
 2909 Highway 11 South, Meridian, MS 39307

1069082

Foundation Aviation Holdings LLC  
 118 College Dr #5116  
 Hattiesburg, MS 39406  
 Attention: Julian Allen

Aircraft Information:

N777AQ  
 Beech 200, SN BB-583  
 Hobbs 1743.4  
 TAT 9159.0

Item	Description	Rate	Qty/Hrs	Amount
	PO # 1069082 Original date of service 10/20/2010.			
LABOR	1. Trouble shooting intermittent electric elevator trim system. Replaced defective pilot electric elevator trim control switch with new unit.	75.00	3.25	243.75
LABOR	2. Trouble shooting split in L/H and R/H generator output. Adjusted L/H and R/H generator control unit per MM and ran up and ops checked good.	75.00	1.25	93.75
LABOR	3. Trouble shooting INOP R/H strobe light. Swapped L/H and R/H wing flash tube and problem moved to L/H side. Installed new flash tube on L/H side.	75.00	1.5	112.50
LABOR	4. Trouble shooting no off detent for R/H condition lever. Straightened bent lever to catch detent in pedestal.	75.00	1	75.00
LABOR	5. Trouble shooting INOP fuel cross feed system. Operational checked system many times and could not duplicate problem.	75.00	0.5	37.50
LABOR	6. Trouble shooting INOP L/H fuel transfer system in auto position. Replaced defective automatic fuel transfer system printed circuit board with repaired unit. Ran up and ops checked good.	75.00	5.5	412.50
LABOR	7. Corrected loose yaw dampner control knob in cockpit.	75.00	0	0.00
LABOR	8. Trouble shooting fuel leak coming from L/H nacelle. Removed nacelle lower exterior access panel, blew out seeping sump drain and reinstalled inspection panel.	75.00	1	75.00
LABOR	9. Trouble shooting rudder boost system not operating properly. Removed differential pressure switch and tested, checked good and reinstalled. Connected shop air supply to aircraft and tested system and ops checked good. Ran up and ops checked good with engines.	75.00	3.75	281.25

NOTE: On all overhauled items with exchanged cores, there may be an additional charge back if the core requires above normal overhaul parts.

Thank you!

Phone # 601-485-7304 Fax # 601-485-7889

E-mail mdean@meridianairport.com

Subtotal

Sales Tax (0.0%)

Total

Payments/Credits

PLEASE PAY THIS AMT

*ok*  
*Julian Allen*

290681 SA

MAA dba Dean Aircraft Service  
 2909 Highway 11 South  
 Meridian, MS 39307

# Invoice

Date: 11/1/2010 Invoice #: 357  
 Due Date: 12/1/2010 Terms: Net 30

Remit Payment to:  
 MAA dba Dean Aircraft Service  
 2909 Highway 11 South, Meridian, MS 39307

Foundation Aviation Holdings LLC  
 118 College Dr #5116  
 Hattiesburg, MS 39406  
 Attention: Julian Allen

**Aircraft Information:**

N777AQ  
 Beech 200, SN BB-583  
 Hobbs 1743.4  
 TAT 9159.0

Item	Description	Rate	Qty/Hrs	Amount
LABOR	10. Trouble shooting split in L/H and R/H power lever. Swapped L/H and R/H engine high and low BOV's and engine rigging stayed the same on run ups as they were before. Swapped L/H and R/H engine High & Low BOV's back to their original positions. When running engines R/H power lever popped and then engine was excessively out of rig. Found R/H engine cam box power lever arm splines were stripped and had jumped out of rig. Installed new power lever arm and rigged per MM. Removed L/H and R/H engine reversing cables due to stiff operation, cleaned, lubed and reinstalled. Ran up and rigged engines as needed and ops checked good.	75.00	18	1,350.00
	SUBTOTAL LABOR			2,681.25
101-364086-7	PC Board, Fuel Transfer (SN S615)	1,163.50	1	1,163.50T
309-4301	Rocker Switch	291.43	1	291.43T
50-944076-7	Lever Arm	156.66	1	156.66T
55-0221-1	Flash Tube	91.24	1	91.24T
SW6CRV	Spiral Wrap	1.23	2	2.46T
MS29512-12	O-Ring	0.43	1	0.43T
TY524M	Tyrap	0.06	1	0.06T
TY525M	Tyrap	0.08	1	0.08T
MS24665-153	Cotterpin	0.11	1	0.11T
MS24665-132	Cotterpin	0.11	6	0.66T
	SUBTOTAL PARTS			1,706.63
S/H FEE	PC Board Core Return	5.00	1	5.00T
FREIGHT		128.78		128.78T

NOTE: On all overhauled items with exchanged cores, there may be an additional charge back if the core requires above normal overhaul parts.

Thank you!

Phone # 601-485-7304 Fax # 601-485-7889

E-mail mdean@meridianairport.com

Subtotal	\$4,521.66
Sales Tax (0.0%)	\$0.00
<b>Total</b>	<b>\$4,521.66</b>
Payments/Credits	\$0.00
<b>PLEASE PAY THIS AMT</b>	<b>\$4,521.66</b>

*OK*  
*Julian*



# Purchase Order

**USM Purchasing**  
2609 WEST 4TH STREET  
HATTIESBURG MS 39401  
United States

Dispatch via Print

Purchase Order 1069082	Date 11/01/2010	Revision	Page 1
Payment Terms Net 30	2010 NOV 11 PM 2:33	FOB: Destin, flt prep chrg back	Ship Via BESTWAY
Buyer Wyles, Cynthia	Requisition #	Requestor Wyles, Cynthia	

Vendor: 0000041277  
DEAN AIRCRAFT SERVICE  
2909 HIGHWAY 11 SOUTH  
MERIDIAN MS 39307

Ship To: 2609 WEST 4TH STREET  
& HATTIESBURG MS 39401  
United States

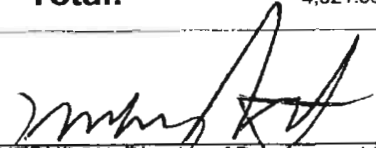
Bill To: 118 COLLEGE DRIVE #5104  
HATTIESBURG MS 39406-0001  
United States

Tax Exempt? Y	Tax Exempt ID: 64-740188K	Dept: Airplane Operations	Dept Id: 100011	Proj/Grnt:	
Line	Quantity	UOM	Item/Description	Unit Price	Extended Amt

1	35.75	HRS	Labor for repairs to airplane	75.00	2,681.25
2	1.00	EA	Miscellaneous parts for repairs to airplane	1,840.41	1,840.41

PER ESTIMATE #2 DATED 10/20/10

**Total:** 4,521.66

BY   
MIKE HERNDON Director of Procurement Services  
Phone (601) 266-4131  
Fax (601) 266-5182

Instructions

CORRESPONDENCE should be addressed to the Purchasing department.  
DISCOUNT period to be from date invoiced or material is received, whichever is later.  
ACKNOWLEDGE order upon receipt and give definite shipping date.  
CHANGES or SUBSTITUTIONS will not be accepted without prior written approval.  
CANCELLATIONS The University of Southern Mississippi reserves the right to cancel all or any part of this order not shipped in accordance with terms and conditions stated above or on vendors quotation.  
EQUAL EMPLOYMENT- This purchase order is subject to the provisions of E.O. 11284 if it exceeds \$10,000 and is not otherwise exempt.

AA/EOE/ADA